



OCX Platinum

Foam Quick Guide

1. Check Substrate

- Clean and free of oil, grease, and frost.
- Moisture ≤19%
- No Visible Condensation

Substrate Temp	Equipment Temp
40-50°F	130°F
50-70°F	125°F
70-115°F	120°F
>115°F	115°F

*Equipment varies and temperature settings need to be confirmed visually.

2. Set Equipment

- Pre-heat A & B to 105-140°F
- Hose 105-140°F
- Verify ratio is 1:1 by volume
- Mix at 10-15 lbs/min for a minimum of 30 minutes before application.

Optimal Pressure	Starting Point
1000-1500 psi	1300 psi - Static

*Starting pressure is dependent on hose length.

3. Apply Foam

- 3:1 transfer pumps for optimal performance.
- Confirm ambient air temp is between 40°F and 120°F.

4. Ventilate

- Minimum 0.3 ACH during spraying
- Keep ventilation for 24 hours post-application
- 1 hour re-entry for other trades
- 24 hours homeowner reoccupation